HEDUICANNO NINE BUILDING REPORT

UNTERGO RECONNEL OFFICE L'AOR IDUCATIONE IN LASSIA

(z)(0)

 $= (1)^{(N)} (1$ 

 $(\mathbf{0})$ 


Innovation in the Management of Primery School Construction in Afghanistan

l = a


enacine Luis Inter National Desgradi Crater

Shice 1984

1949 24 F HB **المركز القومي ليحوث الإسكان والبناء** Housing & Building National Research Center Since 1954

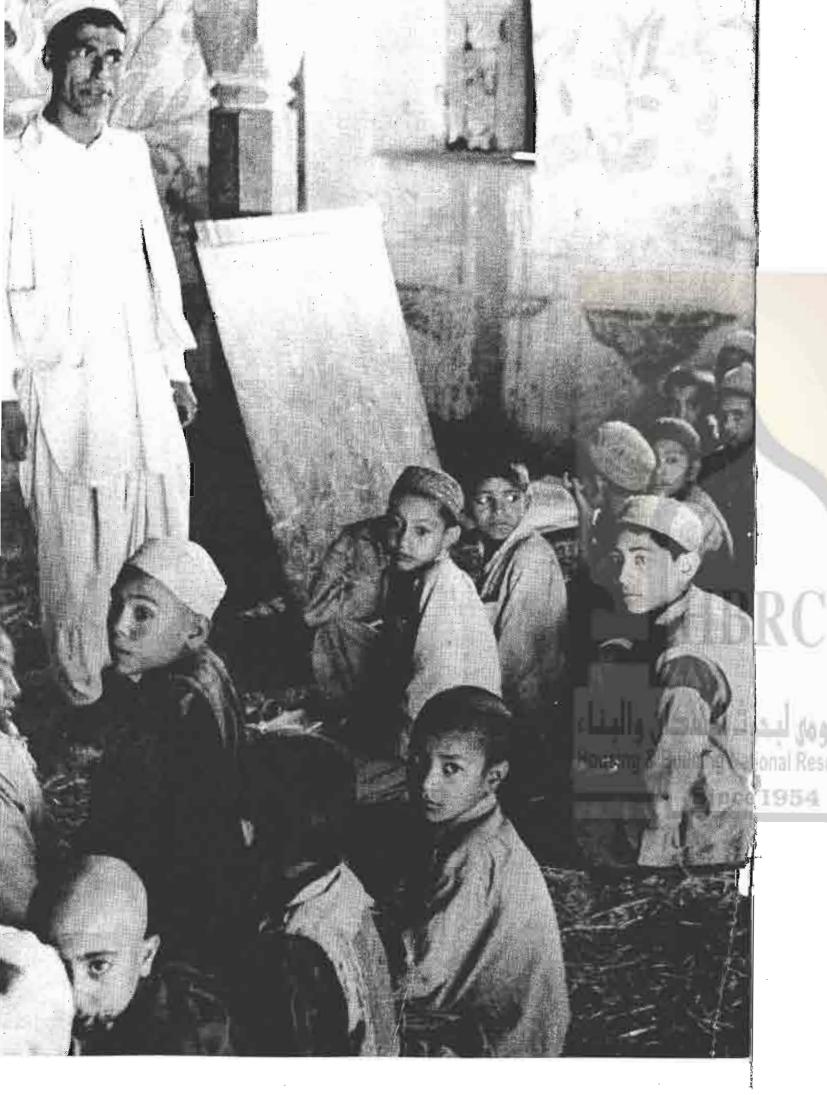


Innovation in the Management of Primary School Construction in Afghanistan



ا ۲ يونيو ۱۹۲۹

EDUCATIONAL BUILDING REPORT

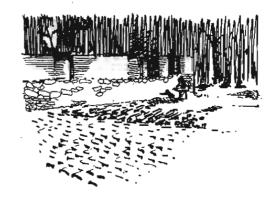



UNESCO REGIONAL OFFICE FOR EDUCATION IN ASIA AND OCEANIA BANGKOK, THAILAND, 1978



-a Case Study by Fazel Ahmad

9

j. 4 A 35

: Primary education in Chapter One : The role of the Educa Chapter Two building design and Unesco 1978  $(\mathbf{C})$ Chapter Three : The primary school p and costs and the co Published by the Unesco Regional Office for Education in Asia and Oceania 920 Sukhumvit Road C.P.O. Box 1425 Bangkok, Thailand Chapter Four : Initial organization fo programme . Printed in Thailand Chapter Five : Management and eval in 1976 . . : Functions of the Dire Annex of Construction base Housing & Building Nat re-organization . Sin

Opinions expressed in this publication represent the views of the author and do not necessarily coincide with the official position of Unesco. No expression of opinion is intended herein concerning the legal status or the delimitations of the frontiers of any country or territory. CONTENTS

The author

v

n the Republic of Afghanistan		1						
• ation Ministry in school construction before 1973	-	8						
programme - building designs onstruction of prototypes •	1:	2						
or the first construction	20	0						
luation of the projects	23	8						
ectorates in the Department ed on the June 1976								
· · · · · · ·	3							

## LIST OF PLATES

	Frontispiece: A school in a mosque		
1.	An urban primary school · · · · · ·		2
2.	A village school in a mosque garden · · · ·	•	3
3.	A village school built by the community and in a state of disrepair		3
4.	Typical roof of a village school	•	3
5.	The combined effects of snow, rain and lack of maintenance on the roof of a village school		3
6.	The village school teacher • • • • • • • • • • • • • • • • • • •	•	6
7.	The children · · · · · · · · ·		6
8.	An unfinished school, abandoned in Kunara .		9
9.	An attempt to use timber over the same large spans as concernsulted in the collapse of this school at Ghazni · ·	rete	9
10.	Earthquake resistance is improved by the inclusion of two sm reinforced concrete ring beams in this school in a remote area of Nangarhar Province near the border with Pakistan	nall	15
11.	A prototype school in Badakshan Province		17
12.	Negotiations for a site for a prototype school, teachers' house and toilet in Wardak Province		18
13.	A completed, prototype school in Wardak Province · ·		18
14.	Example of completed school in Parwan Province, built under the USAID-supported project	•	29
15.	Many buildings were completed but, due to low capacity in th joinery factory, lacked doors and windows	e •	29
16.	Example of school built under the WFP-supported programme and nearing completion at the end of the 1976 construction season	e	30
17.	The use of a continuous U-shaped building often resulted on sloping sites in either (a) very deep foundations or (b) very high foundation walls		31
18.	The cornice wall with outlet looks attractive but it prevents water running freely off the roof and leads to leaks		33

vi

15. 29 gus no è Bullong Ne nal Research Center Since

1.00

2

3

3

3

- LIST OF FIGURES
- 1. Map of the Republic of Afghanist
- 2. The structure of education in Afgh education reform . . .
- 3. The present structure of educatio the education reform .
- 4. The organization of the office of the in the Ministry of Education befo
- 5. Procedures followed for financing ed under the aegis of the Public
- 6. Seismic risk zoning map of the Re
- 7. Teachers' housing initial design
- 8. Village school alternative l in:
- 9. Village school alternative 2 in
- 10. Rural primary school initial des
- 11. Use of a plastic sheet as a waterp in mud roofs . . . .
- 12. Bond stones tie the outer skins of improve earthquake resistance
- 13. The initial prototype design for a to accommodate the eight grades required by the educational refo
- 14. Flow chart showing organization W.F.P.-supported school buildi
  - Flow chart showing organization for materials for W.F.P.-suppo
- 16. Reorganization of the Construction
- 17. Development of the new pattern of
- 18. Flow chart showing organization distribution to the W.F.P.-suppo
- 19. Flow chart showing organization a bution of windows, doors and ro supported projects . .
- 20. Flow chart showing organization bution of plastic sheet and window supported projects . . •

tan						1
hanis	stan ł	pefore	e the			
•	•		•	•		4
n in	Afgh ·	anista	an, aj	fter		5
the P	resid	ent o	f Con	struc	tion	
ore l	973	•	,	14	•	10
		l buil eparti		cons	truct-	11
epubl	lic of	Afgh	ianist	an		13
n		·.				13
itial	desi	gn				14
nitial	desi	.gn				14
sign				,		14
proof	ing n	nemb	rane			
	•	•	•			16
the	wall •	toget]	her to	•		16
s of j	prim	ary e	ool cl ducat	hange ion	d	
	of 197		•	•		20
	istrí rojec		n of f	ood to		22
				noney g proj		23
on De	parti	nent	in Ma	arch l	976	24
forg	aniza	ation	- June	e 1976	5	24
	ment proj	-	uren	nent a	nd	25
-				d dist F.P		26
-			t and W.F.	distr P	i-	
ri i	•	•		•		26

vii